## SAE400 DC ARC WELDING POWER SOURCE


For use with machines having Code Number 10664, 10665

August, 2001

#### Lincoln arc welding and cutting equipment is designed and built with safety in mind. However, your overall safety can be increased by proper installation ... and thoughtful operation on your part. **DO NOT**

Safety Depends on You

tion on your part. DO NOT INSTALL, OPERATE OR REPAIR THIS EQUIPMENT WITHOUT READING THIS MANUAL AND THE SAFETY PRECAUTIONS CONTAINED THROUGHOUT. And, most importantly, think before you act and be careful.

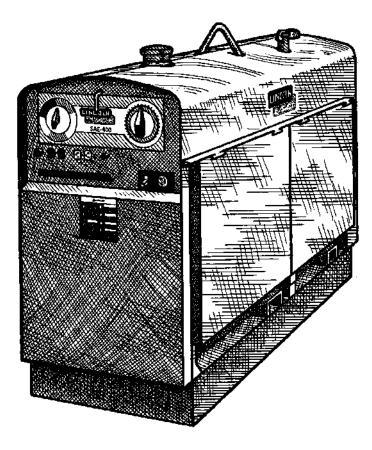

Date of Purchase:_	
Serial Number:	
Code Number:	
Model:	
Where Purchased:	



## **OPERATOR'S MANUAL**





Copyright © 2001 Lincoln Global Inc.

World's Leader in Welding and Cutting Products •

 $\bullet$  Sales and Service through Subsidiaries and Distributors Worldwide  $\bullet$ 

Cleveland, Ohio 44117-1199 U.S.A. TEL: 216.481.8100 FAX: 216.486.1751 WEB SITE: www.lincolnelectric.com

## SAFETY

## WARNING

### ▲ CALIFORNIA PROPOSITION 65 WARNINGS

Diesel engine exhaust and some of its constituents are known to the State of California to cause cancer, birth defects, and other reproductive harm. The engine exhaust from this product contains chemicals known to the State of California to cause cancer, birth defects, or other reproductive harm.

The Above For Diesel Engines

The Above For Gasoline Engines

#### ARC WELDING CAN BE HAZARDOUS. PROTECT YOURSELF AND OTHERS FROM POSSIBLE SERIOUS INJURY OR DEATH. KEEP CHILDREN AWAY. PACEMAKER WEARERS SHOULD CONSULT WITH THEIR DOCTOR BEFORE OPERATING.

Read and understand the following safety highlights. For additional safety information, it is strongly recommended that you purchase a copy of "Safety in Welding & Cutting - ANSI Standard Z49.1" from the American Welding Society, P.O. Box 351040, Miami, Florida 33135 or CSA Standard W117.2-1974. A Free copy of "Arc Welding Safety" booklet E205 is available from the Lincoln Electric Company, 22801 St. Clair Avenue, Cleveland, Ohio 44117-1199.

## BE SURE THAT ALL INSTALLATION, OPERATION, MAINTENANCE AND REPAIR PROCEDURES ARE PERFORMED ONLY BY QUALIFIED INDIVIDUALS.



# FOR ENGINE powered equipment.

- 1.a. Turn the engine off before troubleshooting and maintenance work unless the maintenance work requires it to be running.
  - 1.b. Operate engines in open, well-ventilated areas or vent the engine exhaust fumes outdoors.



1.c. Do not add the fuel near an open flame welding arc or when the engine is running. Stop the engine and allow it to cool before refueling to prevent spilled fuel from vaporizing on contact with hot engine parts and igniting. Do not spill fuel when filling tank. If fuel is spilled, wipe it up and do not start engine until fumes have been eliminated.

- 1.d. Keep all equipment safety guards, covers and devices in position and in good repair.Keep hands, hair, clothing and tools away from V-belts, gears, fans and all other moving parts when starting, operating or repairing equipment.
- 1.e. In some cases it may be necessary to remove safety guards to perform required maintenance. Remove guards only when necessary and replace them when the maintenance requiring their removal is complete. Always use the greatest care when working near moving parts.



1.f. Do not put your hands near the engine fan. Do not attempt to override the governor or idler by pushing on the throttle control rods while the engine is running.

1.g. To prevent accidentally starting gasoline engines while turning the engine or welding generator during maintenance work, disconnect the spark plug wires, distributor cap or magneto wire as appropriate.



1.h. To avoid scalding, do not remove the radiator pressure cap when the engine is hot.



## ELECTRIC AND MAGNETIC FIELDS may be dangerous

- 2.a. Electric current flowing through any conductor causes localized Electric and Magnetic Fields (EMF). Welding current creates EMF fields around welding cables and welding machines
- 2.b. EMF fields may interfere with some pacemakers, and welders having a pacemaker should consult their physician before welding.
- 2.c. Exposure to EMF fields in welding may have other health effects which are now not known.
- 2.d. All welders should use the following procedures in order to minimize exposure to EMF fields from the welding circuit:
  - 2.d.1. Route the electrode and work cables together Secure them with tape when possible.
  - 2.d.2. Never coil the electrode lead around your body.
  - 2.d.3. Do not place your body between the electrode and work cables. If the electrode cable is on your right side, the work cable should also be on your right side.
  - 2.d.4. Connect the work cable to the workpiece as close as possible to the area being welded.
  - 2.d.5. Do not work next to welding power source.

Mar '95



## ELECTRIC SHOCK can kill. 3.a. The electrode and work (or ground) circuits


are electrically "hot" when the welder is on. Do not touch these "hot" parts with your bare skin or wet clothing. Wear dry, hole-free gloves to insulate hands.

3.b. Insulate yourself from work and ground using dry insulation. Make certain the insulation is large enough to cover your full area of physical contact with work and ground.

In addition to the normal safety precautions, if welding must be performed under electrically hazardous conditions (in damp locations or while wearing wet clothing; on metal structures such as floors, gratings or scaffolds; when in cramped positions such as sitting, kneeling or lying, if there is a high risk of unavoidable or accidental contact with the workpiece or ground) use the following equipment:

- Semiautomatic DC Constant Voltage (Wire) Welder.
- DC Manual (Stick) Welder.
- AC Welder with Reduced Voltage Control.
- 3.c. In semiautomatic or automatic wire welding, the electrode, electrode reel, welding head, nozzle or semiautomatic welding gun are also electrically "hot".
- 3.d. Always be sure the work cable makes a good electrical connection with the metal being welded. The connection should be as close as possible to the area being welded.
- 3.e. Ground the work or metal to be welded to a good electrical (earth) ground.
- 3.f. Maintain the electrode holder, work clamp, welding cable and welding machine in good, safe operating condition. Replace damaged insulation.
- 3.g. Never dip the electrode in water for cooling.
- 3.h. Never simultaneously touch electrically "hot" parts of electrode holders connected to two welders because voltage between the two can be the total of the open circuit voltage of both welders.
- 3.i. When working above floor level, use a safety belt to protect yourself from a fall should you get a shock.
- 3.j. Also see Items 6.c. and 8.

## ARC RAYS can burn.

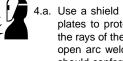

4.a. Use a shield with the proper filter and cover plates to protect your eyes from sparks and the rays of the arc when welding or observing open arc welding. Headshield and filter lens should conform to ANSI Z87. I standards.

- 4.b. Use suitable clothing made from durable flame-resistant material to protect your skin and that of your helpers from the arc rays.
- 4.c. Protect other nearby personnel with suitable, non-flammable screening and/or warn them not to watch the arc nor expose themselves to the arc rays or to hot spatter or metal.



## FUMES AND GASES can be dangerous.

5.a. Welding may produce fumes and gases hazardous to health. Avoid breathing these fumes and gases.When welding, keep your head out of the fume. Use enough ventilation and/or exhaust at the arc to keep

fumes and gases away from the breathing zone. When welding with electrodes which require special ventilation such as stainless or hard facing (see instructions on container or MSDS) or on lead or cadmium plated steel and other metals or coatings which produce highly toxic fumes, keep exposure as low as possible and below Threshold Limit Values (TLV) using local exhaust or mechanical ventilation. In confined spaces or in some circumstances, outdoors, a respirator may be required. Additional precautions are also required when welding on galvanized steel.

- 5.b. Do not weld in locations near chlorinated hydrocarbon vapors coming from degreasing, cleaning or spraying operations. The heat and rays of the arc can react with solvent vapors to form phosgene, a highly toxic gas, and other irritating products.
- 5.c. Shielding gases used for arc welding can displace air and cause injury or death. Always use enough ventilation, especially in confined areas, to insure breathing air is safe.
- 5.d. Read and understand the manufacturer's instructions for this equipment and the consumables to be used, including the material safety data sheet (MSDS) and follow your employer's safety practices. MSDS forms are available from your welding distributor or from the manufacturer.
- 5.e. Also see item 1.b.

Mar '95





# CYLINDER may explode if damaged.

7.a. Use only compressed gas cylinders containing the correct shielding gas for the process used and properly operating regulators designed for the gas and All becas fittings at a bruid he switchle for

pressure used. All hoses, fittings, etc. should be suitable for the application and maintained in good condition.

- 7.b. Always keep cylinders in an upright position securely chained to an undercarriage or fixed support.
- 7.c. Cylinders should be located:
  Away from areas where they may be struck or subjected to physical damage.
  - A safe distance from arc welding or cutting operations and any other source of heat, sparks, or flame.
- 7.d. Never allow the electrode, electrode holder or any other electrically "hot" parts to touch a cylinder.
- 7.e. Keep your head and face away from the cylinder valve outlet when opening the cylinder valve.
- 7.f. Valve protection caps should always be in place and hand tight except when the cylinder is in use or connected for use.
- 7.g. Read and follow the instructions on compressed gas cylinders, associated equipment, and CGA publication P-I, "Precautions for Safe Handling of Compressed Gases in Cylinders," available from the Compressed Gas Association 1235 Jefferson Davis Highway, Arlington, VA 22202.

# FOR ELECTRICALLY powered equipment.

- 8.a. Turn off input power using the disconnect switch at the fuse box before working on the equipment.
- 8.b. Install equipment in accordance with the U.S. National Electrical Code, all local codes and the manufacturer's recommendations.
- 8.c. Ground the equipment in accordance with the U.S. National Electrical Code and the manufacturer's recommendations.

Mar '95



• WELDING SPARKS can • cause fire or explosion. 6.a. Remove fire hazards from the welding area.

If this is not possible, cover them to prevent the welding sparks from starting a fire. Remember that welding sparks and hot materials from welding can easily go through small cracks and openings to adjacent areas. Avoid welding near

hydraulic lines. Have a fire extinguisher readily available.

- 6.b. Where compressed gases are to be used at the job site, special precautions should be used to prevent hazardous situations. Refer to "Safety in Welding and Cutting" (ANSI Standard Z49.1) and the operating information for the equipment being used.
- 6.c. When not welding, make certain no part of the electrode circuit is touching the work or ground. Accidental contact can cause overheating and create a fire hazard.
- 6.d. Do not heat, cut or weld tanks, drums or containers until the proper steps have been taken to insure that such procedures will not cause flammable or toxic vapors from substances inside. They can cause an explosion even though they have been "cleaned". For information, purchase "Recommended Safe Practices for the Preparation for Welding and Cutting of Containers and Piping That Have Held Hazardous Substances", AWS F4.1 from the American Welding Society (see address above).
- 6.e. Vent hollow castings or containers before heating, cutting or welding. They may explode.
- 6.f. Sparks and spatter are thrown from the welding arc. Wear oil free protective garments such as leather gloves, heavy shirt, cuffless trousers, high shoes and a cap over your hair. Wear ear plugs when welding out of position or in confined places. Always wear safety glasses with side shields when in a welding area.
- 6.g. Connect the work cable to the work as close to the welding area as practical. Work cables connected to the building framework or other locations away from the welding area increase the possibility of the welding current passing through lifting chains, crane cables or other alternate circuits. This can create fire hazards or overheat lifting chains or cables until they fail.
- 6.h. Also see item 1.c.



## **PRÉCAUTIONS DE SÛRETÉ**

Pour votre propre protection lire et observer toutes les instructions et les précautions de sûreté specifiques qui parraissent dans ce manuel aussi bien que les précautions de sûreté générales suivantes:

#### Sûreté Pour Soudage A L'Arc

- 1. Protegez-vous contre la secousse électrique:
  - a. Les circuits à l'électrode et à la piéce sont sous tension quand la machine à souder est en marche. Eviter toujours tout contact entre les parties sous tension et la peau nue ou les vétements mouillés. Porter des gants secs et sans trous pour isoler les mains.
  - b. Faire trés attention de bien s'isoler de la masse quand on soude dans des endroits humides, ou sur un plancher metallique ou des grilles metalliques, principalement dans les positions assis ou couché pour lesquelles une grande partie du corps peut être en contact avec la masse.
  - c. Maintenir le porte-électrode, la pince de masse, le câble de soudage et la machine à souder en bon et sûr état defonctionnement.
  - d.Ne jamais plonger le porte-électrode dans l'eau pour le refroidir.
  - e. Ne jamais toucher simultanément les parties sous tension des porte-électrodes connectés à deux machines à souder parce que la tension entre les deux pinces peut être le total de la tension à vide des deux machines.
  - f. Si on utilise la machine à souder comme une source de courant pour soudage semi-automatique, ces precautions pour le porte-électrode s'applicuent aussi au pistolet de soudage.
- Dans le cas de travail au dessus du niveau du sol, se protéger contre les chutes dans le cas ou on recoit un choc. Ne jamais enrouler le câble-électrode autour de n'importe quelle partie du corps.
- Un coup d'arc peut être plus sévère qu'un coup de soliel, donc:
  - a. Utiliser un bon masque avec un verre filtrant approprié ainsi qu'un verre blanc afin de se protéger les yeux du rayonnement de l'arc et des projections quand on soude ou quand on regarde l'arc.
  - b. Porter des vêtements convenables afin de protéger la peau de soudeur et des aides contre le rayonnement de l'arc.
  - c. Protéger l'autre personnel travaillant à proximité au soudage à l'aide d'écrans appropriés et non-inflammables.
- 4. Des gouttes de laitier en fusion sont émises de l'arc de soudage. Se protéger avec des vêtements de protection libres de l'huile, tels que les gants en cuir, chemise épaisse, pantalons sans revers, et chaussures montantes.
- 5. Toujours porter des lunettes de sécurité dans la zone de soudage. Utiliser des lunettes avec écrans lateraux dans les zones où l'on pique le laitier.

- Eloigner les matériaux inflammables ou les recouvrir afin de prévenir tout risque d'incendie dû aux étincelles.
- Quand on ne soude pas, poser la pince à une endroit isolé de la masse. Un court-circuit accidental peut provoquer un échauffement et un risque d'incendie.
- 8. S'assurer que la masse est connectée le plus prés possible de la zone de travail qu'il est pratique de le faire. Si on place la masse sur la charpente de la construction ou d'autres endroits éloignés de la zone de travail, on augmente le risque de voir passer le courant de soudage par les chaines de levage, câbles de grue, ou autres circuits. Cela peut provoquer des risques d'incendie ou d'echauffement des chaines et des câbles jusqu'à ce qu'ils se rompent.
- Assurer une ventilation suffisante dans la zone de soudage. Ceci est particuliérement important pour le soudage de tôles galvanisées plombées, ou cadmiées ou tout autre métal qui produit des fumeés toxiques.
- 10. Ne pas souder en présence de vapeurs de chlore provenant d'opérations de dégraissage, nettoyage ou pistolage. La chaleur ou les rayons de l'arc peuvent réagir avec les vapeurs du solvant pour produire du phosgéne (gas fortement toxique) ou autres produits irritants.
- Pour obtenir de plus amples renseignements sur la sûreté, voir le code "Code for safety in welding and cutting" CSA Standard W 117.2-1974.

## PRÉCAUTIONS DE SÛRETÉ POUR LES MACHINES À SOUDER À TRANSFORMATEUR ET À REDRESSEUR

- Relier à la terre le chassis du poste conformement au code de l'électricité et aux recommendations du fabricant. Le dispositif de montage ou la piece à souder doit être branché à une bonne mise à la terre.
- 2. Autant que possible, l'installation et l'entretien du poste seront effectués par un électricien qualifié.
- Avant de faires des travaux à l'interieur de poste, la debrancher à l'interrupteur à la boite de fusibles.
- 4. Garder tous les couvercles et dispositifs de sûreté à leur place.

Mar. '93





Thank You — for selecting a QUALITY product by Lincoln Electric. We want you to take pride in operating this Lincoln Electric Company product ••• as much pride as we have in bringing this product to you!

#### Please Examine Carton and Equipment For Damage Immediately

When this equipment is shipped, title passes to the purchaser upon receipt by the carrier. Consequently, Claims for material damaged in shipment must be made by the purchaser against the transportation company at the time the shipment is received.

Please record your equipment identification information below for future reference. This information can be found on your machine nameplate.

Model Name & Number

Code & Serial Number	

Date of Purchase

Whenever you request replacement parts for or information on this equipment always supply the information you have recorded above.

Read this Operators Manual completely before attempting to use this equipment. Save this manual and keep it handy for guick reference. Pay particular attention to the safety instructions we have provided for your protection. The level of seriousness to be applied to each is explained below:

## 

This statement appears where the information **must** be followed **exactly** to avoid **serious personal injury** or loss of life.

## **CAUTION**

This statement appears where the information **must** be followed to avoid **minor personal injury** or **damage to** this equipment.

## TABLE OF CONTENTS

vi

Installation InstructionsSection ATechnical SpecificationsA-1Installation PrecautionsA-2Location / VentilationA-2StackingA-2Angle of OperationA-2LiftingA-2High Altitude OperationA-3TowingA-3Pre-Operation Engine and Compressor ServiceA-3Engine OilA-3FuelA-3Angine Cooling SystemA-4Battery ConnectionA-4Spark ArresterA-4Welding Output CablesA-5
Machine Grounding
Operating InstructionsSection BSafety InstructionsB-1Additional Safety PrecautionsB-1General DescriptionB-1Recommended ApplicationsB-1WelderB-1Auxiliary PowerB-1Compressed AirB-1Design Features and AdvantagesB-2Duty CycleB-2Engine Controls: Function/OperationB-3Welder Controls: Function/OperationB-3Remote ControlB-4Auxiliary Power ControlsB-4Fingine OperationB-5Starting InstructionsB-5Typical Fuel ConsumptionB-5
Accessories
Maintenance       Section D         Routine Maintenance       D-1         Periodic Maintenance       D-1         Troubleshooting Guide       Section E
Wiring Diagrams and Dimension Print Section F
Parts Lists



## **TECHNICAL SPECIFICATIONS - SAE400**

			INPUT - DIE	SEL ENGINE				
Make/Model	Descr	iption	Speed (RPM)	Displacement		tarting ystem	Capacities	
Perkins 4.236 Diesel Engine	4 cyl 63 HP 1725 F	@	High Idle 1800 Low Idle 1100 Full Load 1725	236 cu. in (3.87 L)		2VDC batteries ) & Starter	Fuel: 22.5 gal. 85.1 L	
Ligine	17231			Bore x Stroke	•		Oil: 8.5 Qts. 8.04 L	
				3.875" x 5.00" (98.4 mm x 127.0	mm)		Coolant: 3.6 gal. 13.63 L	
			RATED OUTP		R			
Duty Cycle <sup>(1)</sup>			Welding Out	tput		Volts at Rat	ed Amps	
60% (NEMA)			400 amps	400 amps		36 volts	6 volts	
60% (Lincoln Plus	s)		400 amps		40 volts	40 volts		
		OUT	<b>FPUT - WELDEF</b>	R AND GENE	RATC	R		
Welding Range         Open Circuit Voltage         Auxiliary Power								
80 - 575 /	Amps		97 Max. OCV @ 1800 RPM 115/230 VAC 3000 Watts, 60 Hz. 100% Duty Cycle					
			PHYSICAL [	DIMENSIONS				
HEIGHT		WID	TH	DEPTH	1		WEIGHT	
50.13 in.		28.0	0 in.	83.00 ii	n.		2125 lbs.	
1273.3 m	m	711.	2 mm	2108.2	mm		963.9 kg	

<sup>(1)</sup> Based on a 10 minute period.

SAE400

Read this entire installation section before you start installation.

## SAFETY PRECAUTIONS

## 

Do not attempt to use this equipment until you have thoroughly read all operating and maintenance manuals supplied with your machine. They include important safety precautions, detailed engine starting, operating and maintenance instructions and parts lists.



#### ELECTRIC SHOCK can kill.

•Do not touch electrically live parts such as output terminals or internal wiring.

•Insulate yourself from the work and ground.

•Always wear dry insulating gloves.



#### ENGINE EXHAUST can kill.

•Use in open, well ventilated areas or vent exhaust outside

•Do not stack anything near the engine.



#### MOVING PARTS can injure.

•Do not operate with doors open or guards off.

•Stop engine before servicing.

•Keep away from moving parts

Only qualified personnel should install, use or service this equipment

## LOCATION/VENTILATION

The welder should be located to provide an unrestricted flow of clean, cool air to the cooling air inlets and to avoid restricting the cooling air outlets. Also, locate the welder so that the engine exhaust fumes are properly vented to an outside area.

### STACKING

These machines cannot be stacked.

### ANGLE OF OPERATION

To achieve optimum engine performance the machine should be run in a level position. The maximum angle of operation for the Perkins engine is 40 degrees in all directions. If the engine is to be operated at an angle, provisions must be made for checking and maintaining the oil level at the normal (FULL) oil capacity in the engine crankcase. When operating the welder at an angle, the effective fuel capacity will be slightly less than the specified 22.5 gallons.

### LIFTING

The equipment lift bale should be used to lift the machine.

### 🏠 WARNING



## FALLING EQUIPMENT can cause injury.

•Do not lift this machine using lift bale if it is equipped with a heavy accessory such as a trailer or gas cylinder.

•Lift only with equipment of adequate lifting capacity.

•Be sure machine is stable when lifting.



### HIGH ALTITUDE OPERATION

At higher altitudes, output derating may be necessary. As a rule of thumb, derate the welder output 5% for every 500 meters (1640 ft.) above 1000 meters (3280 ft.).

Contact a Perkins Service Representative for any engine adjustments that may be required for high altitude operation.


### TOWING

The recommended trailers for use with this equipment for in-plant and yard towing by a vehicle<sup>(1)</sup> are Lincoln's K767-1, K956-1 and K956-2. The K956-1 and K956-2 are also designed to be used at highway speeds<sup>(1)</sup>. If the user adapts a non-Lincoln trailer, he must assume responsibility that the method of attachment and usage does not result in a safety hazard nor damage the welding equipment. Some of the factors to be considered are as follows:

- 1. Design capacity of trailer vs. weight of Lincoln equipment and likely additional attachments.
- 2. Proper support of, and attachment to, the base of the welding equipment so that there will be no undue stress to the trailer's framework.
- 3. Proper placement of the equipment on the trailer to insure stability side to side and front to back when being moved and when standing by itself.
- 4. Typical conditions of use, such as travel speed, roughness of surface on which the trailer will be operated, and environmental conditions.
- 5. Proper preventative maintenance of trailer.
- 6. Conformance with federal, state and local laws.1
- <sup>(1)</sup> For highway use, consult applicable federal, state and local laws regarding specific requirements for use on public highways, such as brakes, lights, fenders, etc.

## **PRE-OPERATION ENGINE SERVICE**

READ the engine operating and maintenance instructions supplied with this machine.

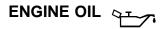

The engine is shipped with the engine crankcase filled with high quality SAE 10W-30 oil (API class CD or better). Check the oil level before starting the engine. If it is not up to the full mark on the dip stick, add oil as required. Check the oil level every four hours of running time during the first 35 running hours. Refer to the engine Operator's Manual for specific oil recommendations and break-in information. The oil change interval is dependent on the quality of the oil and the operating environment. Refer to the engine Operator's Manual for the proper service and maintenance intervals.

### FUEL USE DIESEL FUEL ONLY



## A WARNING

•Stop engine and allow to cool before fueling.

- •Do not smoke when fueling.
- •Fill fuel tank at a moderate rate and do not overfill.
- •Wipe up spilled fuel and allow fumes to clear before starting engine.
- •Keep sparks and flame away from tank.

Fill the fuel tank with clean, fresh diesel fuel. The capacity of the fuel tank is 22.5 gallons (85.1 liters). See engine Operator's Manual for specific fuel recommendations.

**NOTE:** Before starting the engine, be sure the fuel shutoff valve on the sediment bowl is open by turning the handle counterclockwise.



### **ENGINE COOLING SYSTEM**

The cooling system has been filled at the factory with a 50-50 mixture of ethylene glycol antifreeze and water. Check the radiator level and add a 50-50 solution as needed. (See Engine Manual or antifreeze container for alternate antifreeze recommendation.)

### **BATTERY CONNECTION**

**WARNING:** Use caution as the electrolyte is a strong acid that can burn skin and damage eyes.

Remove and discard the insulating caps from the negative battery terminals. Attach and tighten negative battery cable terminals.

**NOTE:** This machine is furnished with wet charged batteries; if unused for several months, the batteries may require a booster charge. Be careful to charge the batteries with the correct polarity. Make sure that the batteries are level while charging.

### 



GASES FROM BATTERY can explode.Keep sparks, flame and cigarettes

away from battery.

To prevent EXPLOSION when:

- INSTALLING A NEW BATTERY disconnect negative cable from old battery first and connect to new battery last.
- CONNECTING A BATTERY CHARGER remove battery from welder by disconnecting negative cable first, then positive cable and battery clamp. When reinstalling, connect negative cable last. Keep well ventilated.
- USING A BOOSTER connect positive lead to battery first then connect negative lead to negative battery lead at the lower control panel support.

BATTERY ACID can burn eyes and skin.

- Wear gloves and eye protection and be careful when working near battery.
- Follow instructions printed on battery.

-----

**IMPORTANT:** To prevent ELECTRICAL DAMAGE WHEN:

- a) Installing new batteries.
- b) Using a booster.

Use correct polarity — **Negative Ground**.

To prevent BATTERY BUCKLING, tighten nuts on batteries only until snug. **DO NOT OVERTIGHTEN**.

#### SPARK ARRESTER

Some federal, state or local laws may require that gasoline or diesel engines be equipped with exhaust spark arresters when they are operated in certain locations where unarrested sparks may present a fire hazard. The standard muffler included with this welder does not qualify as a spark arrester. When required by local regulations, a suitable spark arrester must be installed and properly maintained.

## 

An incorrect arrester may lead to damage to the engine or adversely affect performance. Contact the engine manufacturer for specific recommendations.



### WELDING OUTPUT CABLES

With the engine off, connect the electrode and work cables to the studs provided. These connections should be checked periodically and tightened if necessary.

Listed in Table A.1 are copper cable sizes recommended for the rated current and duty cycle. Lengths stipulated are the distance from the welder to work and back to the welder again. Cable sizes are increased for greater lengths primarily for the purpose of minimizing cable voltage drop.

#### Table A.1 Combined Length of Electrode and Work Cables.

	TOTAL COMBINED LENGTH OF ELEC- TRODE AND WORK CABLES		
AMPS @60% Duty Cycle	Up to 100 FT.	100-200 FT.	200-250 FT.
400	2/0 AWG	3/0 AWG	4/0 AWG

#### MACHINE GROUNDING

Because this portable engine driven welder creates its own power, it is not necessary to connect its frame to an earth ground, unless the machine is connected to premises wiring (home, shop, etc.). To prevent dangerous electric shock, other equipment powered by this engine driven welder must:

- a) be grounded to the frame of the welder using a grounded type plug, or
- b) be double insulated.

When this welder is mounted on a truck or trailer, its frame must be securely connected to the metal frame of the vehicle. When this engine driven welder is connected to premises wiring such as that in a home or shop, its frame must be connected to the system earth ground. See the article on grounding in the latest U.S. National Electrical Code and the local code.

In general, if the machine is to be grounded, it should be connected with a #8 or larger copper wire to a solid earth ground such as a metal water pipe going into the ground for at least ten feet and having no insulated joints, or to the metal framework of a building which has been effectively grounded. The U.S. National Electrical Code lists a number of alternate means of grounding electrical equipment. A machine grounding stud marked with the  $\pm$  symbol is provided on the welding generator frame foot.



## **OPERATING INSTRUCTIONS**

Read and understand this entire section before operating your equipment.

## SAFETY INSTRUCTIONS

### WARNING

Do not attempt to use this equipment until you have thoroughly read all operating and maintenance manuals supplied with your machine. They include important safety precautions, detailed engine starting, operating and maintenance instructions and parts lists.



#### ELECTRIC SHOCK can kill.

•Do not touch electrically live parts such as output terminals or internal wiring.

•Insulate yourself from the work and ground.

•Always wear dry insulating gloves.



#### ENGINE EXHAUST can kill.

•Use in open, well ventilated areas or vent exhaust outside

•Do not stack anything near the engine.



#### MOVING PARTS can injure.

•Do not operate with doors open or guards off.

•Stop engine before servicing.

•Keep away from moving parts

Only qualified personnel should operate this equipment.

### ADDITIONAL SAFETY PRECAUTIONS

Always operate the welder with the hinged doors closed as these provide maximum protection from moving parts and insure proper cooling air flow.

Read carefully the Safety Precautions page in the Instruction Manual before operating this machine. Always follow these and any other safety procedures included in this manual and in the engine and compressor instruction manuals.

## **GENERAL DESCRIPTION**

The SAE400 is a diesel engine driven welding power source. The machine uses a DC generator for DC stick electrode welding and an AC exciter for 115/230 VAC auxiliary power. As a generator it can supply up to 3,000 watts of 115/230 volt AC power. As a welder it provides up to 575 amps of DC constant current output.

The engine is a 63 Hp (47 kw), 4-cylinder water cooled diesel made by Perkins.

### **RECOMMENDED APPLICATIONS**

#### WELDER

The SAE400 provides excellent constant current DC welding output for stick (SMAW) welding. The field installed optional CV Adapter (K385-1) provides up to 500 amps at 35 volts of constant voltage output for semiautomatic welding.

#### **AUXILIARY POWER**

The SAE400 provides 3 KW of 115/230 VAC output for auxiliary power and emergency standby power.



**B-1** 

### **DESIGN FEATURES AND ADVANTAGES**

#### FOR STICK WELDING

- Excellent DC constant current output for stick welding applications.
- Continuous adjustment of both voltage and current for unsurpassed welds on demanding jobs.
- Remote control capability standard.

#### FOR AUXILIARY POWER

- 3,000 watts of 115/230 VAC, 60 Hz auxiliary power.
- One 20 amp 115 VAC duplex receptacle for up to 26 amps of 115 VAC power.
- One 15 amp, 230 VAC duplex receptacle for up to 13 amps of 230 VAC power.
- Weld and AC auxiliary power at the same time (within the limits shown on the chart below).

Welding Current, Amps @ NEMA Arc Volts	Using Only 115V Circuit, Amps	Using Only 230V Circuit, Amps	Total Aux. kVA
0	26	13	3.0
100	19.5	9.75	2.25
200	13	6.5	1.5
300	6.5	3.25	0.75
400	0	0	0

#### **OTHER FEATURES**

- Perkins 4-cylinder, water cooled diesel engine. Designed for long life, easy maintenance and excellent fuel economy.
- Engine protection system shuts the engine down for low engine oil pressure or high coolant temperature.
- Gauges for engine oil pressure, coolant temperature and battery charging ammeter.
- Engine hour meter standard.
- Extended range 22.5 gallon (85.1 L) fuel tank.

### DUTY CYCLE

Duty cycle is based on a ten minute period and operation in an ambient temperature of 104°F(40°C).

The SAE400 is NEMA rated at 60% duty cycle. Duty cycle is based on a ten minute period. Therefore, a 60% duty cycle welder can be operated at nameplate rated output for 6 minutes out of every 10 minute period without overheating.

The auxiliary power can be used continuously (100% duty cycle) within its rated current capacities.



### **ENGINE CONTROLS**

#### **IGNITION SWITCH**

When placed in the "ON" position, this switch energizes the fuel solenoid. When placed in the "OFF" position, the flow of fuel to the injection pump is stopped to shut down the engine.

#### SPEED CONTROL LEVER

Manually allows the engine to run at its high idle speed controlled by the governor or at the factory set low idle speed. When welding or using auxiliary power the speed control lever must be in the "RUN" position. To reduce the engine to low idle speed when not welding or not using auxiliary power place the speed control lever in the "IDLE" position notch.

#### ENGINE TEMPERATURE GAUGE

Displays the coolant temperature in the engine block.

#### ENGINE OIL PRESSURE GAUGE

Displays the oil pressure to the engine. When the engine starts running, watch for the oil pressure to build up. If no pressure shows within 30 seconds, stop the engine and consult the engine instruction manual.

#### **BATTERY CHARGING AMMETER**

Displays the current going from the charging alternator into the batteries. It is normal for charging current to be high (above 15 amps) after starting or when the batteries are 'low' on charge.

#### **ENGINE HOUR METER**

The engine hour meter records the total running time on the engine in hours. It can be used to keep a record of maintenance on the engine and or welder.

#### ENGINE PROTECTION SYSTEM

The engine protection system shuts down the engine under high coolant temperature or low engine oil pressure conditions by allowing the fuel solenoid valve to close.

#### WELDER CONTROLS POLARITY SWITCH

Turn the Arc Polarity switch to electrode positive or electrode negative as required for each particular application.

#### CONTROL OF WELDING CURRENT Purpose of Controls

The continuous "Current Control" is the main current adjuster. The "Job Selector" is both a fine current adjuster and the continuous Open Circuit Voltage adjuster. Open Circuit Voltage (OCV) controls the arc characteristics.

#### "Job Selector"

The "Job Selector" dial is divided into four colored sections providing OCV ranges as follows:

Color	Title	OCV Range
White	Large Electrodes	High OCV
Black	Normal Welding	Medium OCV
Red	<b>Overhead &amp; Vertical</b>	Low OCV
Grey	Special Applications	Extra-Low OCV

The "Job Selector" is usually set in the black range because it provides a soft "Buttering " arc desired for most welding. Some operators prefer to set the "Job Selector" in the red range for a snappy "Digging" arc when welding vertical up or overhead.

#### "Current Control"

### CAUTION

Do not adjust the "Current Control" while welding because this can damage the control.

The "Current Control" dial is calibrated in amperes on three separate colored dials corresponding to the white, black and red ranges of the "Job Selector" dial. For example: when the "Job Selector" is set on the black range, the approximate welding current is indicated on the black scale of the "Current Control" dial.



#### How to Set the Controls

Assume you want a normal soft arc and about 135 amps, using a 5/32" (4.0 mm) electrode:

- 1. Set the "Job Selector" at the center of the black range.
- 2. Set the "Current Control" to read 135 amps on the black dial.
- 3. Start to weld.
- If you want a little more current, turn the "Job Selector" up (counterclockwise) to increase current. If you want a little less current, turn the "Job Selector" down (clockwise) to decrease current.
- 5. If dialing the desired current with the "Job Selector" moves the setting outside the black range causing undesirable arc characteristics, turn the "Job Selector" back to the center of the black range. Then turn the "Current Control" up or down a little as needed. Readjust the "Job Selector" for the exact characteristics and current desired.

### **REMOTE CONTROL (K1278-2 ONLY)**

A receptacle and "Local/Remote" control switch on the front control panel and a remote control box with 25 ft. (7.6 m) of cord for adjusting the OCV at the welding site are standard. Putting the switch in the "REMOTE" position allows fine current control at the remote control box while placing the switch in the "LOCAL" position allows fine current control at the "Job Selector" on the machine. When using the optional field installed CV adapter (K385-1) the "Local/Remote" switch is only active in the "VV" mode.

#### **AUXILIARY POWER CONTROLS**

#### 115 VAC Receptacle

One 20 amp, 115 VAC duplex receptacle provides 115 VAC for auxiliary power. A total of 26 amps can be drawn from this receptacle.

#### 230 VAC Receptacle

One 15 amp, 230 VAC duplex receptacle provides 230 VAC for auxiliary power. A total of 13 amps can be drawn from this receptacle.

#### **Circuit Breakers**

The circuit breakers provide separate overload current protection for each half of the 115 V duplex receptacle. The circuit breakers provide overload current protection in both current carrying wires of the 230 V duplex receptacle.

#### **Ground Stud**

Provides a connection point for connecting the machine to earth ground. For the safest grounding procedure refer to "Machine Grounding" in the INSTALLA-TION section of this manual.



## **ENGINE OPERATION**

## 

Do not adjust the high idle engine speed (rpm) above the factory setting specification.

### STARTING INSTRUCTIONS

Be sure all Pre-Operation Maintenance has been performed. (See INSTALLATION section of this manual). To start the engine, place ignition toggle switch in the "ON" position. Engage the starter button. When the engine starts running, observe the engine oil pressure. If no pressure shows within 30 seconds, stop the engine and consult the engine operating manual. To stop the engine, place the ignition toggle switch in the "OFF" position.

When an engine is started for the first time, some of the oil will be needed to fill the passages of the lubricating system. Therefore, on initial starting, run the engine for about five minutes and then stop the engine and recheck the oil. If the level is down, fill to the full mark again. The engine controls were properly set at the factory and should require no adjusting when received.

For added safety always operate the welder with the doors closed. Further, leaving the doors open changes the designed air flow and may cause engine or generator overheating.

#### **Cold Weather Starting**

## 

Never use any other starting aids, such as ether, when using the "Thermostart" system.

When overnight temperatures are between  $10^{\circ}F$  (- $12^{\circ}C$ ) and freezing, use the standard "Thermostart" starting system installed on all engines. Follow the instructions on the start panel nameplate and in the engine manual shipped with the welder. With fully charged batteries and the proper weight oil, the "Thermostart" system operates satisfactorily even down to about  $0^{\circ}F$  (- $18^{\circ}C$ ).

If the engine must be frequently started below 10°F (-12°C), it may be desirable to remove the "Thermostart" and install the optional ether starter kit. Installation and operating instructions are included in the kit. Use ether starting only when required because excessive use shortens engine life.

#### **BREAK-IN PERIOD**

#### ENGINE

The engine used to supply power for your welder is a heavy duty, industrial engine. It is designed and built for rugged use. It is very normal for any engine to use small quantities of oil until the break-in is accomplished. Check the oil level twice a day during the break-in period (about 100 running hours).

**IMPORTANT**: IN ORDER TO ACCOMPLISH THIS BREAK-IN, THE UNIT SHOULD BE SUBJECTED TO HEAVY LOADS, WITHIN THE RATING OF THE MACHINE. AVOID LONG IDLE RUNNING PERIODS.

### **TYPICAL FUEL CONSUMPTION**

The typical fuel consumption of the SAE400 for various operating scenarios is shown below:

Low Idle - No Load	.35 gal./ hr.
1100 RPM	(1.32 L./hr.)
High Idle - No Load	.75 gal./hr.
1800 RPM	(2.84 L./hr.)
Welding Load	1.92 gal./hr.
400 Amps, 40 Volts	(7.27 L./hr.)
Auxiliary Power	.96 gal./hr.
3000VA	(3.63 L./hr.)

**K799 Hi-Freq™** - Provides high frequency plus a gas valve for TIG welding. A water valve is available as an option. Requires 115 volt AC input. (Limited to 250A - 60% Duty Cycle).

**K802-D Power Plug Kit -** Kit includes male plugs for each auxiliary receptacle.

**K805-1 Ether Start Kit -** Injects ether for starting aid. Recommended **only** when engines are frequently started at temperatures under 10°F (-12°C). Ether cylinder is **not** included.

**K767-1 Trailer -** A 4-wheel steerable trailer for in-plant and yard towing<sup>(1)</sup> with E78-14 load range (B) tubeless tires. Mounts directly to welder base.

**K956-1 and -2 Trailer -** A 2-wheel trailer designed for road<sup>(1)</sup>, off road, in-plant and yard towing. The K956-2 trailer is equipped with electric brakes. Trailer mounts directly to welder base.

<sup>1</sup>For highway use, consult applicable federal, state and local laws regarding possible requirements for brakes, lights, fenders, etc.

Linc-Thaw<sup>™</sup> (L2964-3) - Includes meter and fuse to protect the welder when thawing frozen water pipes.

## 

Pipe Thawing <u>IS NOT</u> a CSA approved procedure. If not done properly, it can result in fire, explosion, damage to wiring which may make it unsafe, damage to pipes, burning up the welder or other hazards.

**IMPORTANT:** DO NOT USE A WELDER TO THAW A PIPE BEFORE REVIEWING LINCOLN BULLETIN E695.1 (dated October 1987 or later). This bulletin may be obtained from your local Lincoln distributor or by writing directly to Lincoln Electric at the address on the back of this manual.

**K704 Standard Accessory Kit -** Includes electrode and work cables, headshield, work clamp and electrode holder.

**K385-1 CV Adapter -** Provides constant voltage output for semiautomatic welding. (Field installation only).

**K1690-1 GFCI Receptacle Kit -** Includes one UL approved 20 amp, 120 volt ground fault circuit interrupter receptacle (duplex type) and installation instructions.

**K2144-1 Oil Drain Kit -** Includes Ball Vavle, hose and clamp.

C-1



## **WARNING**



#### **ELECTRIC SHOCK can kill.**

Do not touch electrically live parts such as output terminals or internal wiring

ENGINE EXHAUST can kill.

#### Use in open, well ventilated areas or vent exhaust outside



#### MOVING PARTS can injure.

- Do not operate with doors open or guards off
- Stop engine before servicing
- Keep away from moving parts
- Remove guards only when necessary and replace when work requiring removal is complete.
- Only gualified personnel should install, use, or service this equipment.

## **ROUTINE MAINTENANCE**

At the end of each day's welding, refill the fuel tank to minimize moisture condensation in the tank. Also, running out of fuel tends to draw dirt into the fuel system. Check the engine crankcase oil level.

If the fuel supply runs out while the fuel pump is operating, air may be entrapped in the fuel distribution system. If this happens, bleeding of the fuel system may be necessary. See the engine instruction manual.

### FUEL SYSTEM WATER SEPARATOR MAIN-TENANCE

If the fuel system on the engine is equipped with a water separator, the following maintenance procedures must be followed.

Inspect the glass bowl for any accumulation of water on a daily basis. If water is present:

- 1. Insure the fuel shut off valve is in the "open" position.
- 2. Loosen the drain screw on the bottom of the bowl one to two turns or until water begins to flow. Do not remove the screw completely.
- 3. Drain until the water has visibly drained from the bowl and only clear fuel starts to flow from the drain valve.
- 4. Close the drain screw tightly by hand.

Note: Water and fuel should be drained into a suitable container for proper disposal.

#### ENGINE AIR FILTER

The engine air filter is an oil bath style filter. Inspect the air filter daily, more often in dirty or dusty conditions. When necessary, clean the oil cup and replace the oil in the cup (Fill cup to oil line with 10W - 30 oil).

## CAUTION

Never remove the oil cup while the engine is running. Do not over fill the oil cup.

### PERIODIC MAINTENANCE

- 1. Blow out the welder and controls with an air hose at least once every two months. In particularly dirty locations, this cleaning may be necessary once a week. Use low pressure air to avoid driving dirt into the insulation.
- 2. The current control reactor brushes are self-lubricating and should not be greased. Keep the contacts clean. This control should be moved from maximum to minimum daily to prevent the controls from sticking.
- 3. See the engine Instruction Manual for periodic engine maintenance information. Change the crankcase oil at regular intervals using the proper grade of oil as recommended in the engine operating manual. Change the oil filter in accordance with the instructions in the engine operating manual. When the oil filter is changed add one quart of oil to the crankcase to replace the oil held in the filter during operation.
- 4. Belts tend to loosen after the first 30 or 40 hours of operation. Check the cooling fan belt and tighten if necessary. DO NOT OVER TIGHTEN.

#### **BEARING MAINTENANCE**

This welder is equipped with a double-shielded ball bearing having sufficient grease to last indefinitely under normal service. Where the welder is used constantly or in excessively dirty locations, it may be necessary to add one-half ounce of grease per year. A pad of grease one inch wide, one inch long and one inch high weighs approximately one-half ounce. Over greasing is far worse than insufficient greasing.

When greasing the bearings, keep all dirt out of the area. Wipe the fittings completely clean and use clean equipment. More bearing failures are caused by dirt introduced during greasing than from insufficient grease.



ELECTRIC

#### COMMUTATOR AND BRUSH MAINTENANCE

## WARNING

Uncovered rotating equipment can be dangerous. Use care so your hands, hair, clothing or tools do not catch in the rotating parts. Protect yourself from particles that may be thrown out by the rotating armature when stoning the commutator.

The generator brushes are properly adjusted when the welder is shipped. They require no particular attention. DO NOT SHIFT THE BRUSHES or adjust the rocker settina.

Shifting of the brushes may result in:

- Change in machine output
- Commutator Damage
- Excessive brush wear

Periodically inspect the commutator, slip rings and brushes by removing the covers. DO NOT remove or replace these covers while the machine is running.

Commutators and slip rings require little attention. However, if they are black or appear uneven, have them cleaned by an experienced maintenance man using fine sandpaper or a commutator stone. Never use emery cloth or paper for this purpose.

NOTE: If the welder is used in dirty or dusty locations, or if the welder is not used for prolonged periods of time, it may be necessary to clean the commutator and slip rings more often.

Replace brushes when they wear within 1/4" of the pigtail. A complete set of replacement brushes should be kept on hand. Lincoln brushes have a curved face to fit the commutator. Have an experienced maintenance man seat these brushes by lightly stoning the commutator as the armature rotates at full speed until contact is made across the full face of the brushes. After stoning, blow out the dust with low pressure air.

To seat the slip ring brushes, position the brushes in place. Then slide one end of a piece of fine sandpaper between slip rings and brushes with the coarse side against the brushes. With slight additional finger pressure on top of the brushes, pull the sandpaper around the circumference of the rings, in direction of rotation only - until brushes seat properly. In addition, stone slip ring with a fine stone. Brushes must be seated 100%.

Arcing or excessive exciter brush wear indicates a possible misaligned shaft. Have an authorized Field Service Shop check and realign the shaft.

#### **COOLING SYSTEM**

The SAE400 is equipped with a pressure radiator. Keep the radiator cap tight to prevent loss of coolant. Clean and flush the cooling system periodically to prevent clogging the passage and overheating the engine. When antifreeze is needed, always use the permanent type.

**D-2** 



## HOW TO USE TROUBLESHOOTING GUIDE

#### 

Service and Repair should only be performed by Lincoln Electric Factory Trained Personnel. Unauthorized repairs performed on this equipment may result in danger to the technician and machine operator and will invalidate your factory warranty. For your safety and to avoid Electrical Shock, please observe all safety notes and precautions detailed throughout this manual.

This Troubleshooting Guide is provided to help you locate and repair possible machine malfunctions. Simply follow the three-step procedure listed below.

#### Step 1. LOCATE PROBLEM (SYMPTOM).


Look under the column labeled "PROBLEM (SYMP-TOMS)". This column describes possible symptoms that the machine may exhibit. Find the listing that best describes the symptom that the machine is exhibiting.

#### Step 2. POSSIBLE CAUSE.

The second column labeled "POSSIBLE CAUSE" lists the obvious external possibilities that may contribute to the machine symptom. This column provides a course of action for the Possible Cause, generally it states to contact your local Lincoln Authorized Field Service Facility.

If you do not understand or are unable to perform the Recommended Course of Action safely, contact your local Lincoln Authorized Field Service Facility.

#### Step 3. RECOMMENDED COURSE OF ACTION

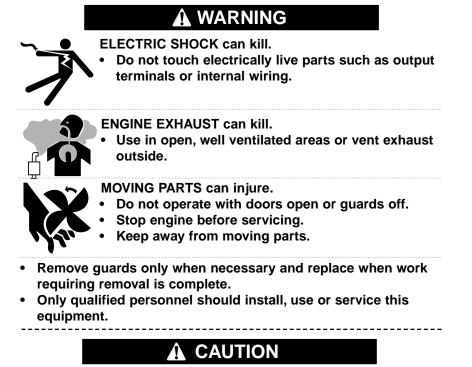

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local** Lincoln Authorized Field Service Facility for technical troubleshooting assistance before you proceed.



E-1

SAE400

E-2

Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
	FUNCTION PROBLEMS	
Machine fails to hold the "heat" constantly.	Rough or dirty commutator.	True and clean commutator.
	Brushes may be worn down to limit of life.	Replace brushes.
	Brush springs may be broken.	Replace brush springs.
	Field circuit may have variable resis- tance connections or intermittent open circuit, due to loose connec- tions or broken wire.	Check field current with ammeter to discover varying current. This applies to both the main generator and exciter.
	Electrode or work lead connections may be poor.	Tighten all connections.
	Wrong grade of brushes may be installed on generator.	Use only the recommended Lincoln brushes.
	Field rheostat may be making poor contact and overheating.	Inspect and clean rheostat.
	"Current Control" may not be operat- ing properly.	Check for loose or missing set screw in control handles.
	"Current Control" brushholder con- tact springs may be worn out or missing. Contact surface may be dirty, rough and pitted.	Inspect. Replace needed parts. Clean internal contact surface of control device. Do not lubricate. Smooth rough surfaces.
	"Current Control" brushholder sup- port stud and mating contact sur- faces may be dirty or pitted and burned.	If brushholder internal contact sur- face is pitted and burned, replace the brushholder and support stud. If the contact surface is dirty, clean off the brushholder stud and internal contact surface. Apply mixture of three parts silicone grease and one part zinc powder (by weight) to stud.
	Engine running at varying speeds.	Set welder controls for maximum output and weld. Then, while weld- ing, check engine rpm. The engine should be running at full speed. If indicator shows a significant differ- ence, consult your engine manual.

## **A** CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local** Lincoln Authorized Field Service Facility for technical troubleshooting assistance before you proceed.



Observe all Safety Guidelines detailed throughout this manual

POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
FUNCTION PROBLEMS	
	Be sure that all brushes bear on the commutator and have proper spring tension.
Exciter may not be operating.	Check exciter output voltage with voltmeter or lamp.
Field circuit of generator or exciter may be open.	Check for open circuits in rheostat, field leads and field coils. Also check resistors.
Polarity reversing switch may be in the neutral position.	Put handle in positive or negative position.
Exciter may have lost excitation.	Check components and continuity in flashing circuit.
Series field circuit may be open cir- cuited. Current setting may be too high. Polarity may be wrong.	Check circuit with ringer or volt- meter. Check setting and current output with ammeter. Check polarity. Try reversing polarity or try an electrode of the opposite polarity.
	FUNCTION PROBLEMS         Generator or exciter brushes may be loose or missing.         Exciter may not be operating.         Field circuit of generator or exciter may be open.         Polarity reversing switch may be in the neutral position.         Exciter may have lost excitation.         Series field circuit may be open circuited.         Current setting may be too high.

## ▲ CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.



Observe all Safety Guidelines detailed throughout this manual

PROBLEMS POSSIBLE CAUSE RECOMMEN		
(SYMPTOMS)		COURSE OF ACTION
	FUNCTION PROBLEMS	
Welding current too great or too small compared to indication on the dial.	"Current Control" shaft and handle may have turned slightly in the insu- lated bushing of the current control brushholder, caused by turning han- dle too hard against one of the stops.	With current control against the min- imum stop, set pointer to within 1/8" of the last scale division.
	Exciter output low causing low out- put compared to dial indication.	Check for shorts in exciter armature with growler.
	"Current Control" set to minimum and welder output so great that engine stalls when arc is struck.	Check to see that series field is properly connected and not shorted.
Welder has output and no control	Local/Remote switch is in wrong position.	Place switch in "LOCAL" position to control output at the welder. Place switch in "REMOTE" position to con- trol output remotely.

## **A** CAUTION


If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local** Lincoln Authorized Field Service Facility for technical troubleshooting assistance before you proceed.

Observe all Safety Guidelines detailed throughout this manual

PROBLEMS (SYMPTOMS)	POSSIBLE CAUSE	RECOMMENDED COURSE OF ACTION
	FUNCTION PROBLEMS	
No auxiliary power	Circuit Breakers open.	Check and reset breakers. If breakers keep tripping check connections to auxiliary receptacles. Also make sure load does nor exceed receptacle's current rating.
	Faulty connections to auxiliary receptacles.	Check connections.

## ▲ CAUTION

If for any reason you do not understand the test procedures or are unable to perform the tests/repairs safely, contact your **Local Lincoln Authorized Field Service Facility** for technical troubleshooting assistance before you proceed.

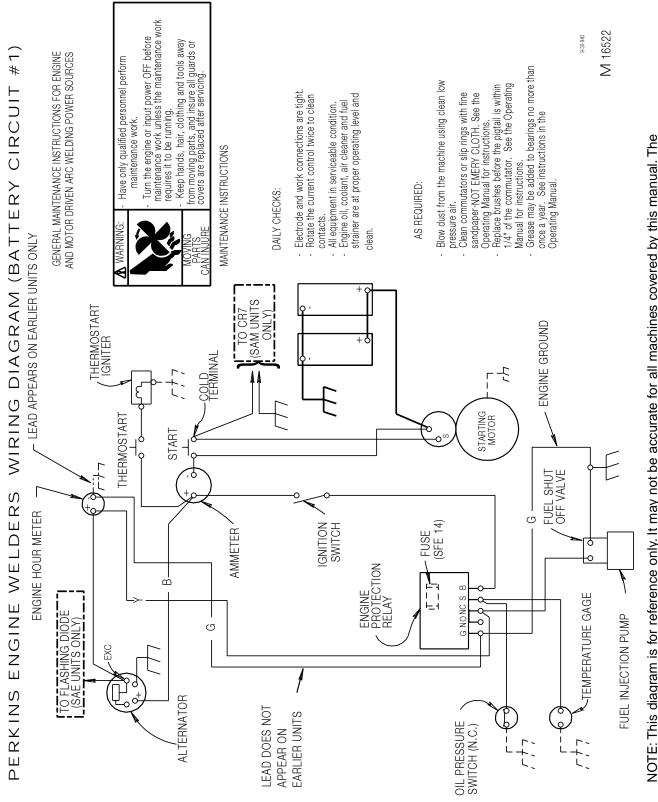


NOTE: This diagram is for reference only. It may not be accurate for all machines covered by this manual. The specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.

WIRING DIAGRAMS

SAE400




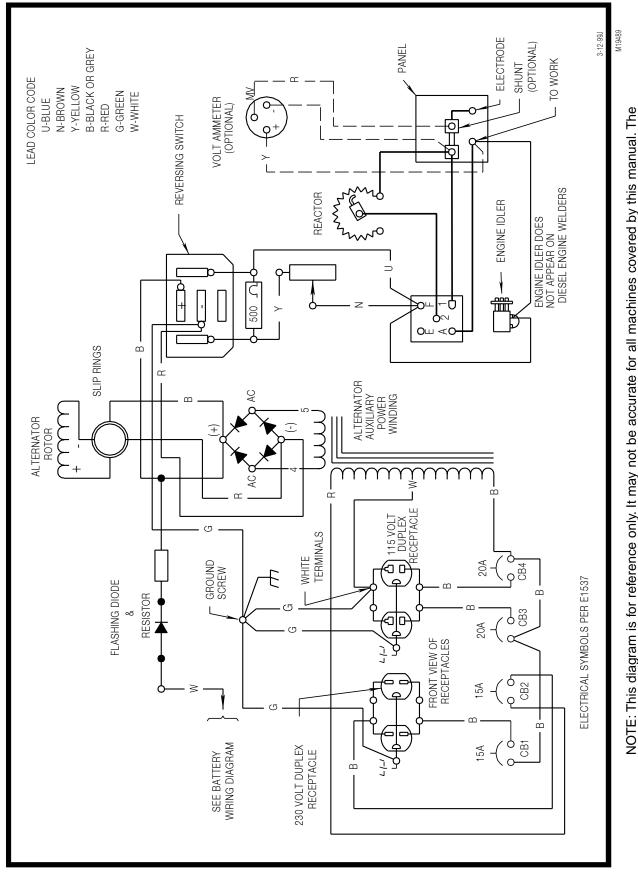

SAE400


specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.



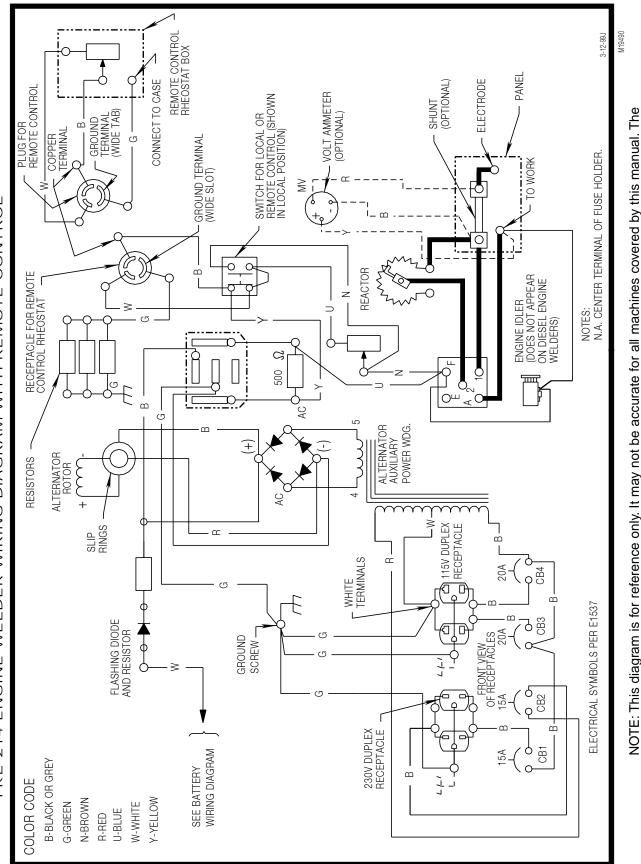

WIRING DIAGRAMS

specific diagram for a particular code is pasted inside the machine on one of the enclosure panels.

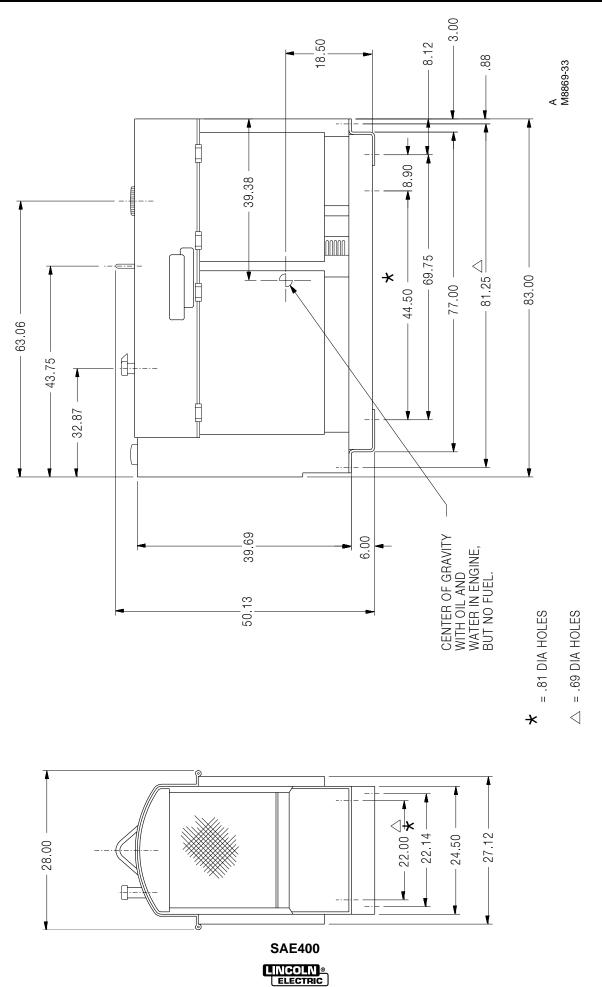

## NOTES

SAE400

#### Now Available...12th Edition The Procedure Handbook of Arc Welding

With over 500,000 copies of previous editions published since 1933, the Procedure Handbook is considered by many to be the "Bible" of the arc welding industry.

This printing will go fast so don't delay. Place your order now using the coupon below.

The hardbound book contains over 750 pages of welding information, techniques and procedures. Much of this material has never been included in any other book.

A must for all welders, supervisors, engineers and designers. Many welding instructors will want to use the book as a reference for all students by taking advantage of the low quantity discount prices which include shipping by 4th class parcel post.

\$15.00 postage paid U.S.A. Mainland

### How To Read Shop Drawings

The book contains the latest information and application data on the American Welding Society Standard Welding Symbols. Detailed discussion tells how engineers and draftsmen use the "short-cut" language of symbols to pass on assembly and welding information to shop personnel.

Practical exercises and examples develop the reader's ability to visualize mechanically drawn objects as they will appear in their assembled form.

187 pages with more than 100 illustrations. Size 8-1/2" x 11" Durable, cloth-covered board binding.

#### New Lessons in Arc Welding

Lessons, simply written, cover manipulatory techniques; machine and electrode characteristics; related subjects, such as distortion; and supplemental information on arc welding applications, speeds and costs. Practice materials, exercises, questions and answers are suggested for each lesson.

528 pages, well illustrated, 6" x 9" size, bound in simulated, gold embossed leather.

\$5.00 postage paid U.S.A. Mainland



### **Need Welding Training?**

The Lincoln Electric Company operates the oldest and most respected Arc Welding School in the United States at its corporate headquarters in Cleveland, Ohio. Over 100,000 students have graduated. Tuition is low and the training is "hands on"

For details write:

Lincoln Welding School 22801 St. Clair Ave. Cleveland, Ohio 44117-1199.

and ask for bulletin ED-80 or call 216-383-2259 and ask for the Welding School Registrar.

Lincoln Welding School

<b>\$4.50</b> postage paid U.S.A. Mainland			ł	5 weeks c	c cou		\$700.00
Orders of \$50 or less before discour Prices include shipment by 4 th UPS Shipping for North Americ	rders of \$50.00 or more for shipment at int or orders outside of North America must Class Book Rate <u>for U.S.A. Mainland</u> <u>ca Only.</u> All prepaid orders that reques	be prepa <u>Only.</u> P	aid with ch lease allo	arge, check ow up to 4	weeks		. Funds Only.
\$5.00	For order value up to \$49.99						
\$10.00	For order value between \$50.00 & \$99.99						
\$15.00	For order value between \$100.00	0 & \$149	9.00				
	rs over \$50.00 & credit card orders, if U prepaid in U.S. Funds. Please add \$2.00 per b		•			•	-
METHOD OF PAYMENT: (Sorr				οι ψ10.00 pe			Shiphient.
	y, NO C.O.D. Olders)	Name	e:				
CHECK ONE:		Addre	ess:				
Please Invoice (only if order is on							
Check or Money Order Enclosed	I, U.S. Funds only						
Credit Card -	Rastel Cost	Telep	hone:				
Account No.  _ _ _ _ _ _ _ _	Exp D	ate   _ Monti	h l_l_ Year	Signatu	ure as it a	appears on Charg	ge Card:
USE THIS FORM TO ORDER: BOOKS OR FREE INFORMATIVE CATALOGS	Order from: BOOK DIVISION, The Lincoln Telephone: 216-383-2211 or, <b>fOr f</b> a						
Lincoln Welding School	Titles:	Price	Code	Quantity	Cost	1	
(ED-80)	New Lessons in Arc Welding	\$5.00	L				
Seminar Information	Procedure Handbook "Twelfth Edition"	\$15.00	PH				
	How to Read Shop Drawings	\$4.50	н			1	
Educational Video Information (ED-93)	Incentive Management	\$5.00	IM				
	A New Approach to Industrial Economics	\$5.00	NA		1		
James F. Lincoln Arc Welding	The American Century of John C. Lincoln	\$5.00	AC			1	
Foundation Book Information	Welding Preheat Calculator	\$3.00	WC-8			]	
(JFLF-515)	Pipe Welding Charts	\$4.50	ED-89				
1	SUB TOTAL						
	Additional Shipping Costs if any						
TOTAL COST							
L					_		



WARNING	<ul> <li>Do not touch electrically live parts or electrode with skin or wet clothing.</li> <li>Insulate yourself from work and ground.</li> </ul>	<ul> <li>Keep flammable materials away.</li> </ul>	Wear eye, ear and body protection.
AVISO DE PRECAUCION	<ul> <li>No toque las partes o los electrodos bajo carga con la piel o ropa mojada.</li> <li>Aislese del trabajo y de la tierra.</li> </ul>	<ul> <li>Mantenga el material combustible fuera del área de trabajo.</li> </ul>	<ul> <li>Protéjase los ojos, los oídos y el cuerpo.</li> </ul>
ATTENTION	<ul> <li>Ne laissez ni la peau ni des vête- ments mouillés entrer en contact avec des pièces sous tension.</li> <li>Isolez-vous du travail et de la terre.</li> </ul>	<ul> <li>Gardez à l'écart de tout matériel inflammable.</li> </ul>	<ul> <li>Protégez vos yeux, vos oreilles et votre corps.</li> </ul>
German WARNUNG	<ul> <li>Berühren Sie keine stromführenden Teile oder Elektroden mit Ihrem Körper oder feuchter Kleidung!</li> <li>Isolieren Sie sich von den Elektroden und dem Erdboden!</li> </ul>	• Entfernen Sie brennbarres Material!	<ul> <li>Tragen Sie Augen-, Ohren- und Kör- perschutz!</li> </ul>
ATENÇÃO	<ul> <li>Não toque partes elétricas e electrodos com a pele ou roupa molhada.</li> <li>Isole-se da peça e terra.</li> </ul>	<ul> <li>Mantenha inflamáveis bem guarda- dos.</li> </ul>	<ul> <li>Use proteção para a vista, ouvido e corpo.</li> </ul>
注意事項	<ul> <li>●通電中の電気部品、又は溶材にヒ フやぬれた布で触れないこと。</li> <li>●施工物やアースから身体が絶縁されている様にして下さい。</li> </ul>	● 燃えやすいものの側での溶接作業 は絶対にしてはなりません。	● 目、耳及び身体に保護具をして下 さい。
Chinese 查告	<ul> <li>●皮肤或濕衣物切勿接觸帶電部件及 銲修。</li> <li>●使你自己與地面和工件絶縁。</li> </ul>	●把一切易燃物品移離工作場所。	●佩戴眼、耳及身體勞動保護用具。
<sup>Korean</sup> 위험	●전도체나 용접봉을 젖은 형겁 또는 피부로 절대 접촉치 마십시요. ● 모재와 접지를 접촉치 마십시요.	●인화성 물질을 접근 시키지 <b>마시요.</b>	●눈, 귀와 몸에 보호장구 <del>물</del> 착용하십시요.
Arabic تحذیر	لا تلمس الاجزاء التي يسري فيها النبار التهرياني أو الالتشرود بجلد الجسم أو بالملابس المبلنة بالماء. ضع عاز لا على جسمك خلال العمل.	<ul> <li>ضع المواد القابلة للاشتعال في مكان بعيد.</li> </ul>	<ul> <li>ضع أدوات وملابس واقبة على عينيك وأذنيك وجستك.</li> </ul>

READ AND UNDERSTAND THE MANUFACTURER'S INSTRUCTION FOR THIS EQUIPMENT AND THE CONSUMABLES TO BE USED AND FOLLOW YOUR EMPLOYER'S SAFETY PRACTICES.

SE RECOMIENDA LEER Y ENTENDER LAS INSTRUCCIONES DEL FABRICANTE PARA EL USO DE ESTE EQUIPO Y LOS CONSUMIBLES QUE VA A UTILIZAR, SIGA LAS MEDIDAS DE SEGURIDAD DE SU SUPERVISOR.

LISEZ ET COMPRENEZ LES INSTRUCTIONS DU FABRICANT EN CE QUI REGARDE CET EQUIPMENT ET LES PRODUITS A ETRE EMPLOYES ET SUIVEZ LES PROCEDURES DE SECURITE DE VOTRE EMPLOYEUR.

LESEN SIE UND BEFOLGEN SIE DIE BETRIEBSANLEITUNG DER ANLAGE UND DEN ELEKTRODENEINSATZ DES HER-STELLERS. DIE UNFALLVERHÜTUNGSVORSCHRIFTEN DES ARBEITGEBERS SIND EBENFALLS ZU BEACHTEN.



	بر ا		
			WARNING
			AVISO DE PRECAUCION
			French ATTENTION
			German WARNUNG
			Portuguese ATENÇÃO
<ul> <li>● ヒュームから頭を離すようにして 下さい。</li> <li>● 換気や排煙に十分留意して下さい。</li> </ul>	● メンテナンス・サービスに取りか かる際には、まず電源スイッチを 必ず切って下さい。	● パネルやカバーを取り外したまま で機械操作をしないで下さい。	Japanese 注意事項
●頭部遠離煙霧。 ●在呼吸區使用通風或排風器除煙。	● 維修前切斷電源。	● <b>儀表板打開</b> 或沒有安全罩時不準作 業。	Chinese 警告
<ul> <li>● 얼굴로부터 용접가스를 멀리하십시요.</li> <li>● 호흡지역으로부터 용접가스를 제거하기 위해 가스제거기나 통풍기를 사용하십시요.</li> </ul>	◆ 보수전에 전원을 차단하십시요.	● 판넬이 열린 상태로 작동치 마십시요.	Korean 위 헙
<ul> <li>ابعد رأسق يعيداً عن الدخان.</li> <li>استعمل التهوية أو جهاز ضغط الدخان للخارج</li> <li>لتي تبعد الدخان عن المنطقة التي تتنفس فيها.</li> </ul>	<ul> <li>اقطع التيار الكهرباني قبل القيام بأية صيانة.</li> </ul>	لا تشغل هذا الجهاز إذا كانت الاغطية الحديدية الواقية ليست عليه.	تحذير

LEIA E COMPREENDA AS INSTRUÇÕES DO FABRICANTE PARA ESTE EQUIPAMENTO E AS PARTES DE USO, E SIGA AS PRÁTICAS DE SEGURANÇA DO EMPREGADOR.

使う機械や溶材のメーカーの指示書をよく読み、まず理解して下さい。そして貴社の安全規定に従って下さい。

請詳細閱讀並理解製造廠提供的説明以及應該使用的銀拝材料,並請遵守貴方的有関勞動保護規定。

이 제품에 동봉된 작업지침서를 숙지하시고 귀사의 작업자 안전수칙을 준수하시기 바랍니다.

اقرأ بتمعن وافهم تعليمات المصنع المنتج لهذه المعدات والمواد قبل استعمالها واتبع تعليمات الوقاية لصاحب العمل.

